



Technical Service Bulletin

Cobra Motorcycle Mfg.

240 Uran street
Hillsdale, MI 49242

(517) 437-9100 phone
(517) 437-9101 fax

TSB0514 2014 Clutch Arbor and Backing Washer

January 9, 2014

Early 2014 clutch arbors are too thick (18.3mm), which places the clutch nut too close to the throw-out gear. This leaves the clutch nut at risk of backing off and damaging the threads of the crankshaft.

Cobra dealers will have the new, thinner clutch arbor (17.3mm) to replace their older thicker clutch arbor (18.3mm). Also, 1 thick three sided backing washer will replace 2 thinner washers. These should be replaced immediately to avoid the risk of costly damage to the end of the crankshaft.