



Technical Service Bulletin

Cobra Moto, LLC

240 Uran Street
Hillsdale, Michigan 49242

(517) 437-9100 phone
(517) 437-9101 fax

~~February 19, 2026, March 20, 2026, April 8, 2026~~


TSB0426 update 2 CX65 Cylinder Stay Bracket

2024 – 2026 CX65's have two cylinder stay brackets (FCC60117) that are too rigid together. Combined they subject the frame and back of cylinder to too high of stress.

The "S" bracket is of insufficient strength. For now use only 1 of the aluminum (FCC60117) brackets and not two of them. They will ultimately fail but its easier and quicker to replace than a frame.

WARNING!

In the meantime, please check the backbone of your frame for signs of cracks (black powder typically visible along the edge of a weld, or if the radiator cap is becoming difficult to remove due to proximity to upper triple clamp. Either of these may be signs of the frame needing replaced.

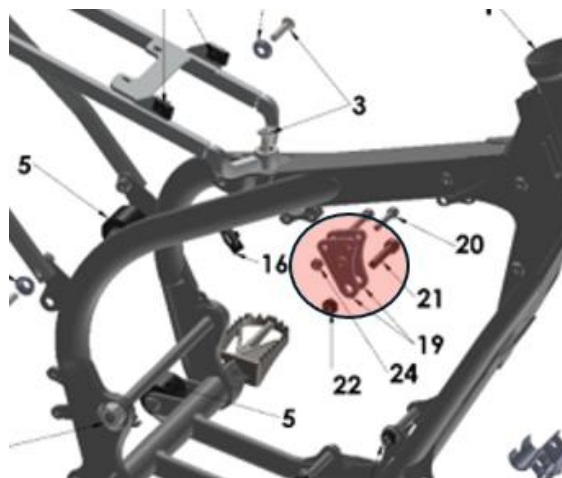

Old dual bracket

DISCLAIMER OF WARRANTY

This motorcycle is sold "as is" with all faults, obvious or not. There are no warranties expressed or implied, including any warranty of merchantability and warranty of fitness for any particular purpose.