Technical Service Bulletin

Cobra Motorcycle Mfg.
240 Uran Street
Hillsdale MI, 49242
(517) 437 9100 phone
(517) 437-9101 fax

TSB0204: 2004 King 50 & CM 50 clutch springs (Belleville washer)

April 1, 2004

Be sure that the assembled spring stack measures 0.484 ± 0.005 (12.3 ± 0.13 mm). To achieve this you may need to rearrange the spring stack into either the three or four 'flying saucer' stack configuration.

Figure 1 - Four stack

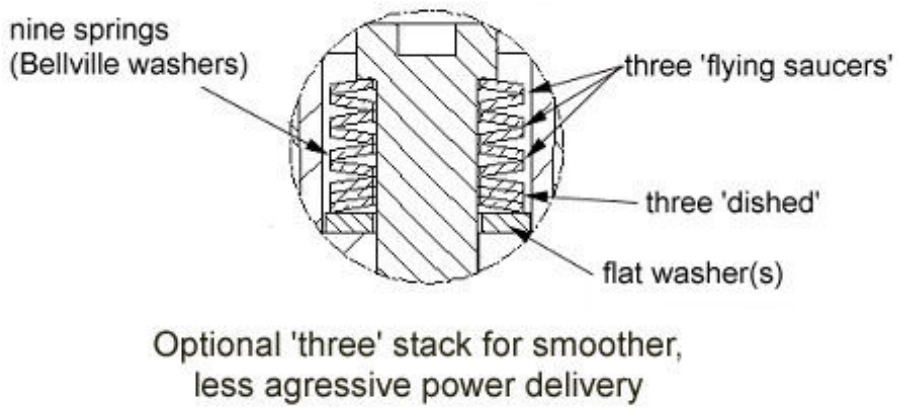

Figure 2 – Three stack