Technical Service Bulletin

Cobra Motorcycle Mfg.

240 Uran street
Hillsdale, MI 49242

(517) 437-9100 phone
(517) 437-9101 fax

TSB1512 Solenoid Care on 2012 CX65

April 25, 2012

In order to keep solenoid wires from breaking, care must be taken not to rotate the solenoid housing when loosening the power valve cap. The cap does not need to be installed very tightly, in fact if the sealing o'ring is lubricated, then hand tight will be sufficient.

To avoid solenoid rotation, it may be necessary to squeeze the solenoid body with a tool.

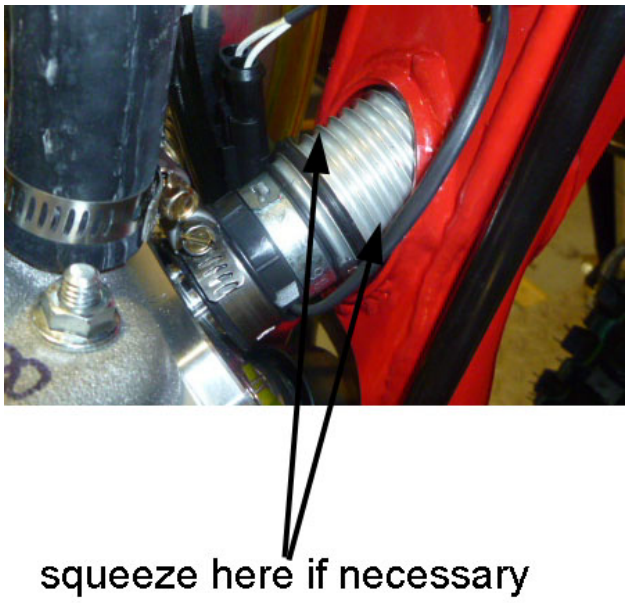

Technical Service Bulletin

Cobra Motorcycle Mfg.

240 Uran street
Hillsdale, MI 49242

(517) 437-9100 phone
(517) 437-9101 fax