# Technical Service Bulletin

**Cobra Motorcycle Mfg.**

**240 Uran street**
**Hillsdale, MI 49242**

**(517) 437-9100 phone**
**(517) 437-9101 fax**

## TSB2212 King and JR Intake Screws Re-tightening

June 25, 2012

The two socket head cap screws that secure the intake boot to the engine on the 2012 King and CX50 JR may require retightening over time. The proper torque is 4.5 ft-lb (55 in-lb, 6 Nm). Insufficient tightness on these screws may cause an air leak.

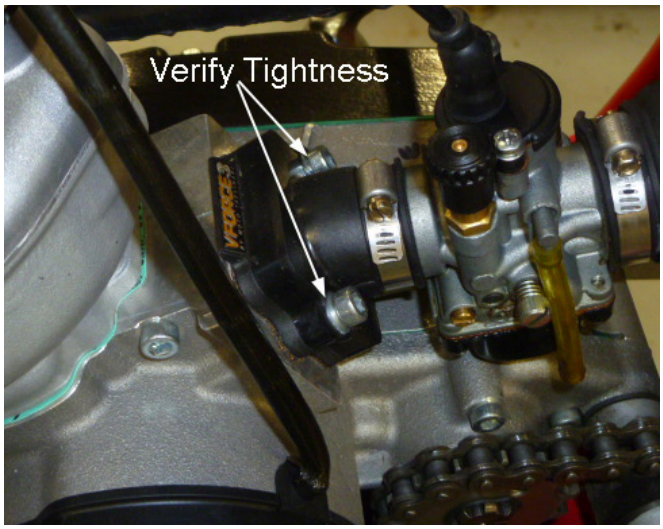


CAUTION

Air leaks downstream of the carburetor can cause jetting irregularities. This can lead to inconsistent throttle response, and in the worst case scenario engine failure.