Technical Service Bulletin

Cobra Moto, LLC
240 Uran Street
Hillsdale, Michigan 49242
(517) 437-9100 phone
(517) 437-9101 fax

July 10, 2018

TSB1418
Strain Relief Throttle Cable to Carb on CX50

To reduce the likelihood of the throttle cable being pulled from top of the carburetor it is recommended to install two 8” zip ties as shown in the pictures below to strain relief the throttle cable to the carburetor top. One zip tie securing the boot to the cable the other securing it to the threaded cable adjuster.

We will be doing this in production going forward.

This applies to all Cobra CX50’s
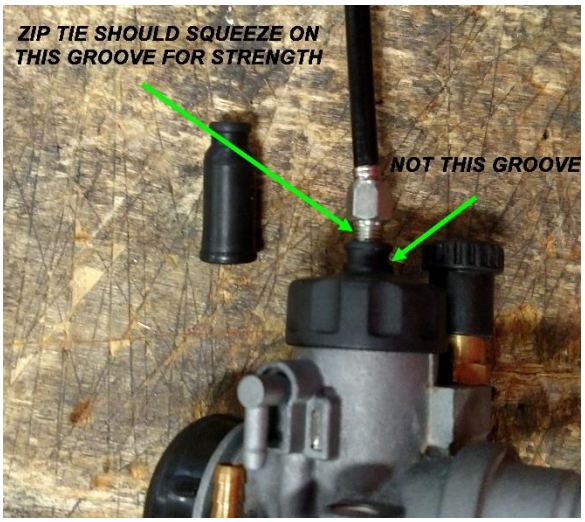
NOTE: For the strongest grip, the bottom (left in the pictures) zip tie should be squeezing on the groove between the hex adjuster and the top, NOT the groove in the carb top.