Technical Service Bulletin

Cobra Motorcycle Mfg.

240 Uran street
Hillsdale, MI 49242

(517) 437-9100 phone
(517) 437-9101 fax

TSB0613V2
POWER VALVE UPGRADE (REVISED)

December 19, 2012

Due to fatigue failures in the CX65 power valve and cable, these components have been upgraded for 2013. Customers can upgrade from 2012 style to 2013 style by machining off the stem from the 2012 valve and inserting a threaded hole (M6 x 1.0 through) in the same location (see picture below).
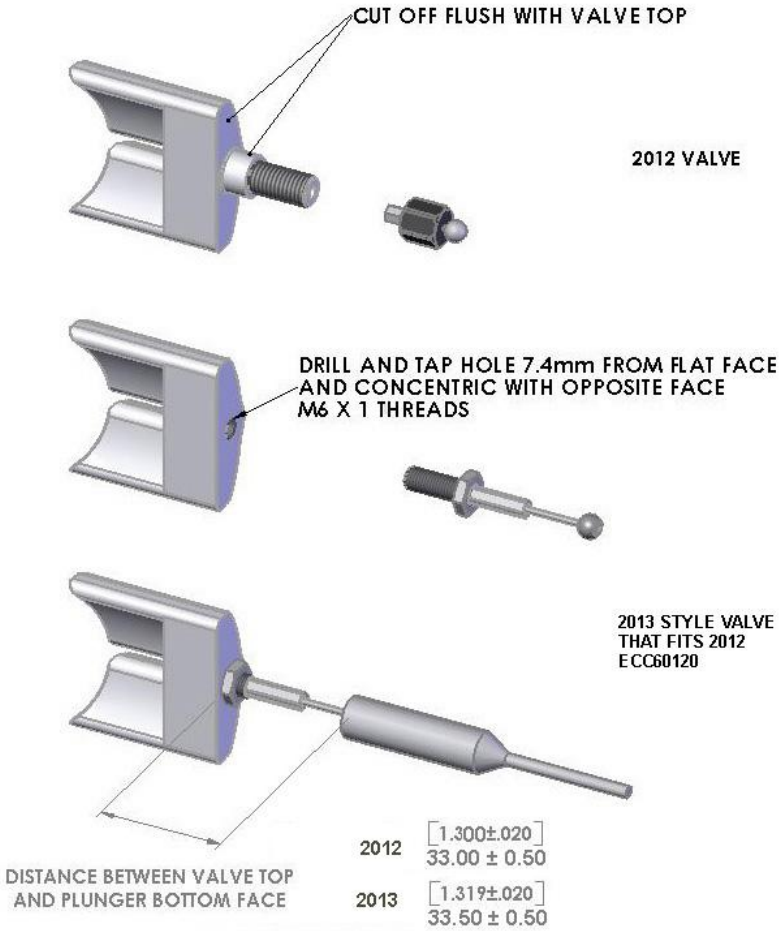
The cable (ECC60155) and jam nut (HCNJ0601) are available through your dealer or Cobra. Secure the Jam nut on the cable to 8Nm (6 ft-lb).