Technical Service Bulletin

Cobra Motorcycle Mfg.

240 Uran street
Hillsdale, MI 49242

(517) 437-9100 phone
(517) 437-9101 fax

TSB1408 CX50 JR / OI radiator

May 1, 2008

The ECMU0061 radiator for the Cobra CX50 JR & OI is being replaced with a silver one being produced by a different supplier. Besides the change in color, there is also a geometry change to the radiator. Most importantly the radiator is larger and so requires some changes to the mounting. Unfortunately the replacement radiator is unique for the JR and OI and has different part numbers.

The part number for the new JR/CM radiator is ECMU0225 (radiator only, no accessories). When an ECMU0061 is ordered from the factory, an automatic substitution will take place and dealer/customer will receive an EKMU0007 kit which includes the new radiator along with new mounting hardware. If an ECMU0225 is ordered just a radiator will ship.

The part number for the new OI/PW3/P3 radiator is ECMU0228 (radiator only, no accessories). When an ECMU0061 is ordered from the factory, an automatic substitution will take place and dealer/customer will receive an EKMU0008 kit which includes the new radiator along with new mounting hardware. If an ECMU0228 is ordered just a radiator will ship.

1. The bottom radiator mount must now be mounted upside down from the previous mounting arrangement. Proper bracket orientation is shown in Figure A and there is a washer between the grommet and the radiator.
2. A spacer is supplied to aid in mounting the radiator in a true horizontal position. The spacer goes between the bracket and the frame on the upper mount (Figure B).

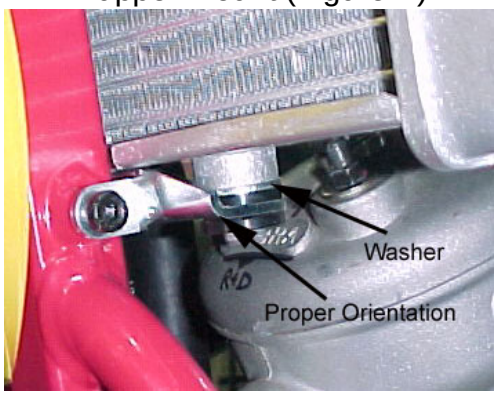

Figure A

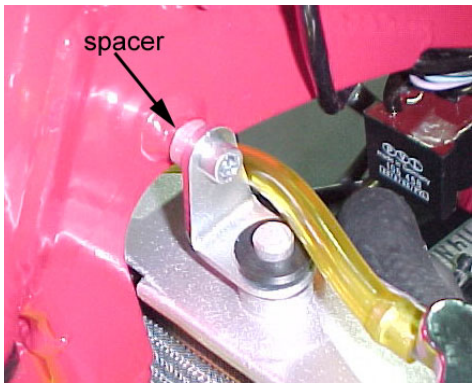

Figure B