

Technical Service Bulletin

Cobra Motorcycle Mfg.

240 Uran street Hillsdale, MI 49242 (517) 437-9100 phone (517) 437-9101 fax

TSB0309 Cobra Frictional Drive (CFD) Version 2 (V2)

September 18, 2008

For 2009 the CFD "slipper" hub/pressure plate and centering washer have been improved. The old CFD hub/pressure plate (EAMU0008) is being discontinued and is being replaced with part number EAMU0010. The EAMU0010 must be used in conjunction with a new centering washer (ECMU0169) which replaces the previous ECMU0160.

This new CFD hub/pressure plate (EAMU0010) is the recommended service replacement part for engines with EAMU0008, or even the older two components setup (hub and pressure plate are separate). When making this replacement a new style centering washer (ECMU0169) must be used along with it.

The new style CFD hub/pressure plate can be identified by the presence of a slight chamfer on the back surface (figure 1). The new style centering washer can be identified by the presence of a large radius on the outer edge (figure 2).

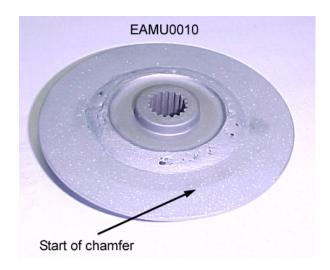






Figure 2