



Technical Service Bulletin

Cobra Moto, LLC

240 Uran Street
Hillsdale, Michigan 49242

(517) 437-9100 phone
(517) 437-9101 fax

February 19, 2026

TSB0426 CX65 Cylinder Stay Bracket


2024 – 2026 CX65's have two cylinder stay brackets (FCMU0117) that are too rigid together. Combined they subject the frame and back of cylinder to too high of stress.

Production is switching to a single "S" bracket which manages the stress between the frame and cylinder.


Your dealers will have a free kit that will replace these brackets with a single alloy formed steel "S" bracket. Please contact your dealer for this kit ASAP. Kit # FKC60004

WARNING!

In the meantime, please check the backbone of your frame for signs of cracks (black powder typically visible along the edge of a weld, or if the radiator cap is becoming difficult to remove due to proximity to upper triple clamp. Either of these may be signs of the frame needing replaced.

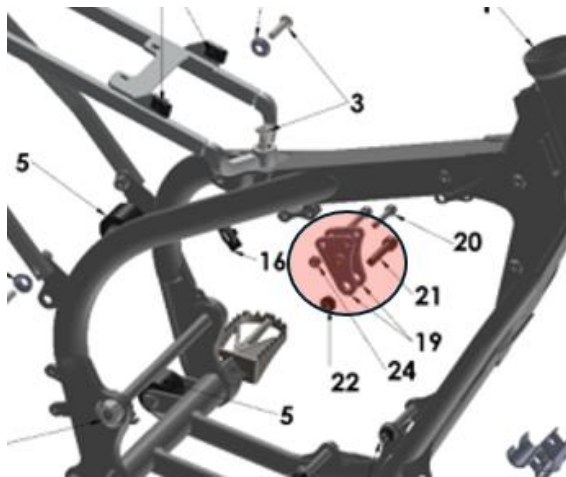

Old dual bracket

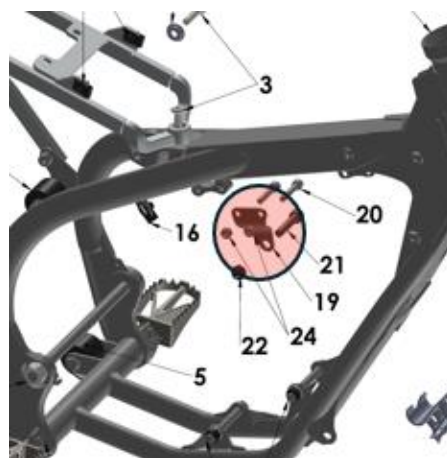

New single bracket

DISCLAIMER OF WARRANTY

This motorcycle is sold "as is" with all faults, obvious or not. There are no warranties expressed or implied, including any warranty of merchantability and warranty of fitness for any particular purpose.